



NOSE ASSEMBLY DATA SHEET

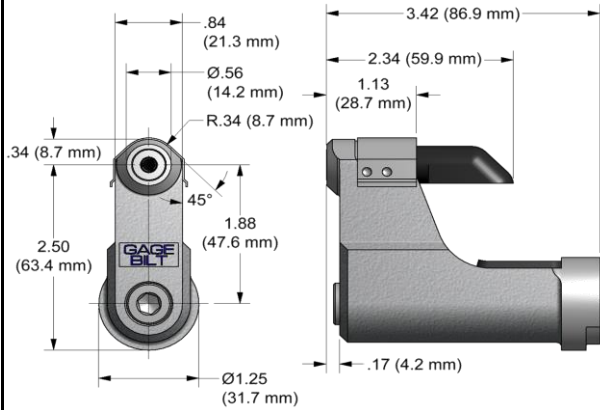

CAUTION:
Pintail may eject forcibly. USE DEFLECTOR TO PREVENT SEVERE PERSONAL INJURY.
Cap (10) use for closed access applications only or when clearance is an issue!

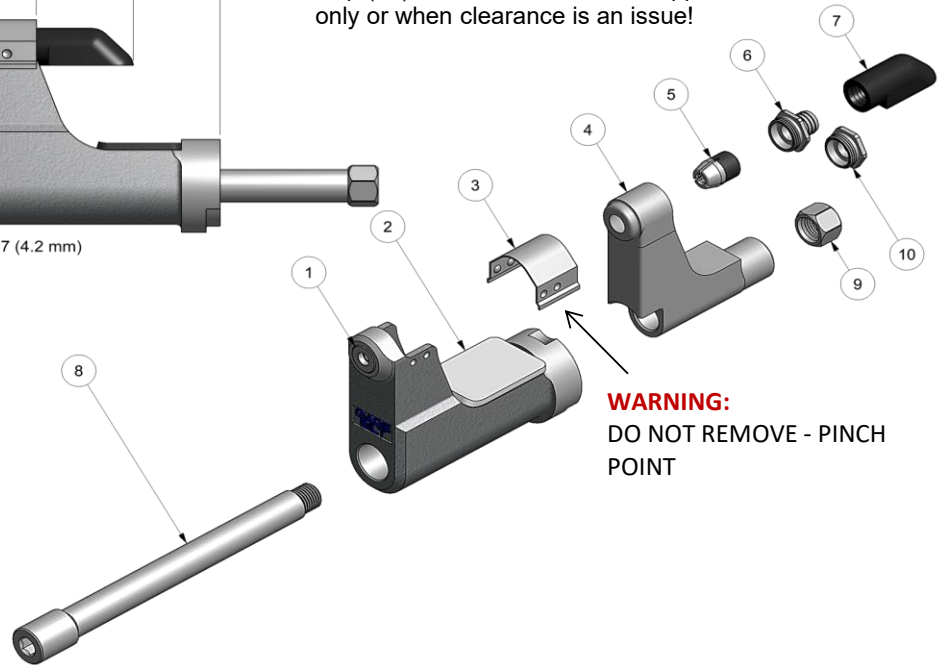

WARNING:
DO NOT REMOVE - PINCH POINT

ATTACHING NOSE ASSEMBLY TO TOOL:

1. Cycle tool to ensure piston is full forward.
2. Disconnect tool from power source.
3. Remove screw and stop from tool.
4. Thread nose assy to tool. Apply Vibra-TITE® part no. 405124 to threads on drawbar.
5. Slide drawbar thru anvil and collet. Screw nut "counterbore in" on rear of drawbar.
6. Connect tool to power source. Cycle the tool to rear position. While holding actuator down, disconnect tool from power source.
7. Using a 1/4" hex wrench and a 1/2" socket wrench, tighten nut on drawbar. Replace screw and stop on tool.
8. Back-off assy, no more than 1/2 turn, to position notch on anvil allowing screw and stop to be reassembled onto tool.



*Use Adapter No. 751204

**Use Adapter No. 353204.

***Use Adapter No. 751204 with 713152 stroke limiter.

5/11 REV. 6/26

GAGE BILT
MADE in USA

44766 Centre Court Clinton Twp. MI 48038 USA
Ph: +1 (586) 226-1500 Fax: +1 (586) 226-1505
solutions1@gagebilt.com / www.gagebilt.com

Type:		Fasteners:		Recommended Tool:	
Non Self-Releasing 5/32", 3/16" & 1/4" Ø		EN6122 & UAB130-EU EN6127 & UAB6127-EU EN6128 & UAB100-EU EN6129 & UABP-EU MAXIBOLT® PLUS		GB204(A)	
				Alternate Tools: *GB722, **GB745 & ***GB713	
Ref. No.	Qty.	Description	UAB05-204D-37OS	UAB06-204D-37OS	UAB08-204D-37OS
1	1	Anvil Insert	15598	16026	18009
2	1	Anvil Assembly (Inc. #1)	13489	13510	13511
3	1	Guard	60426	60426	60426
4	1	Collet	20723	20723	20723
5	1	Super-Grip Jaw Assembly	30545-S8	30656-S9	30864-S12
6	1	Barbed Retainer	70569	70569	70569
7	1	Deflector	61107	61107	61107
8	1	Drawbar	71117	71117	71117
9	1	Nut	71114	71114	71114
10	1	Cap	70571	70571	70571

VIBRA-TITE® IS A REGISTERED TRADEMARK OF OAKLAND CORPORATION. MAXIBOLT® IS A REGISTERED TRADEMARK OF CHERRY AEROSPACE FASTENERS.